

Work Order ID 83303

83303

Page 1

April-17-12 8:33:07 AM

Item ID: D3507-1-BENT Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Skidtube Assembly EC135
 Start Date: 17/04/2012 Start Qty: 2.00 ***2*** Cust Item ID:
 Required Date: 20/04/2012 Req'd Qty: 2.00 ***2*** Customer:
 Reference:

Approvals: Process Plan: MLJ Date: 12/04/17 Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3507	Rev C								

120 BENDING MACHINE - SKIDTUBES 0.00
120
 CNC Bend 1 Memo 0.00 DC 12/05/17
 CNC Delta 100 Bender
 1- Bend tube as per program D3507 on CNC Bender FOLIO 6 and Dwg D3507,
 use DT9632 bending aide
 2- Cut FWD END of tube as per dwg D3507

140 QC5- Inspect part completeness to step on W/O 0.00
140
 QC Memo 0.00 2 12-5-17
 Quality Control.

300 Identify as per dwg & Stock Location: LG 0.00
300
 Packaging Packaging Memo 0.00 DC 12/05/17
 Packaging

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 83303

83303

Page 2

April-17-12 8:33:07 AM

Item ID: D3507-1-BENT Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Skidtube Assembly EC135
 Start Date: 17/04/2012 Start Qty: 2.00 ***2*** Cust Item ID:
 Required Date: 20/04/2012 Req'd Qty: 2.00 ***2*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
310	QC21- Final Inspection - Work Order Release	0.00							
310									
QC	Memo	0.00							
Quality Control									

12/5/22

mk

12-05-22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

April-17-12 8:33:11 AM

Page: 1

Work Order ID: 83303

83303

Parent Item: D3507-1-BENT

D3507-1-BENT

Parent Item Name: Skidtube Assembly EC135

Start Date: 17/04/2012

Required Date: 20/04/2012

Start Qty: 2.00

Required Qty: 2.00

Comments: IPP rev A 10.09.17 new issue EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2962-150		Manufactured	No			100	Each	32.0000	1	2			
D2962-150									**			22 12/08/17	
3.540 Outer Tube, Extrud													

Location

HALL

59934

Loc Qty

32

32

Loc Code

2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 83303 MLJ
12/04/17



Qty	Part Number	Description
X	D3507-041	SKIDTUBE ASSEMBLY
1	D2962-150	EXTRUSION
1	D2965	CAP
1	D2965-3	CAP
4	D3492-041	PLUG ASSEMBLY
4	D3492-043	PLUG ASSEMBLY
2	D3492-047	PLUG ASSEMBLY
2	D3504-1	CROSS BOLT SPACER
1	D3504-3	CROSS BOLT SPACER
2	D3504-5	CROSS BOLT SPACER
1	D3505-1	WEB
4	D3506-1	DOUBLER
2	D3506-3	DOUBLER
1	D3508-1	WEARPLATE
1	D3508-3	WEARPLATE
1	D3508-5	WEARPLATE
1	D3508-7	WEARPLATE
1	D3558-1	GASKET
1	D3558-3	GASKET
1	D3558-5	GASKET
1	D3558-7	GASKET
38	AELS-1032-130	INSERT
1	AELS-1032-225	INSERT
31	AN3C4A	BOLT
2	AN3C5A	BOLT
2	AN526C1032-10	SCREW
33	AN960C10L	WASHER
12	MS20601AD4W3	RIVET

GENERAL NOTES:

- 1) FINISH:
CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3505-1 WEB. POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3. ANTI-SKID PAINT AS INDICATED TO 1.00 ABOVE CENTER LINE PER DART QSI 005 4.4
- 2) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 3) DIMENSIONS: INCHES UNLESS OTHERWISE NOTED
- 4) WELDING TO BE DONE PER DART QSI 004
- 5) INSERT D3505-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 AFTER BENDING
- 6) USE DART DRILL TEMPLATE DT8868 TO LOCATE AND DRILL Ø0.297 HOLES (38 PLACES) FOR WEARSHOE INSERTS. INSTALL AELS-1032-130 PER SECTION C-C (38 PLACES) AFTER FINISH. SEAL WEARPLATE BOLTS WITH SIKAFLEX-241/-291.
- 7) DO NOT INSTALL AN3C4A BOLTS AND AN960C10L WASHERS IN INDICATED LOCATIONS

C	ADD D3504-5, FOR SKID GEAR DEFLECTOR; CHANGE FWD CAP BOLT TO AN526C1032-10 SCREW	DC	07.09.19
B	ADD GASKET, CHANGE HARDWARE MAT'L	PH	06.11.01
A	NEW ISSUE	PH	06.04.21
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC PORT HADLOCK, WA	
DRAWN	JTC		
CHECKED	PH		
MFG. APPR.	PH		
APPROVED	PH		
DE APPR.	PH	DRAWING NO. D3507	
DATE	07.09.19	TITLE EC 135 SKIDTUBE	
		REV. C SHEET 1 OF 2	
		SCALE NTS	
COPYRIGHT © 2006 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

RELEASED
07.11.16

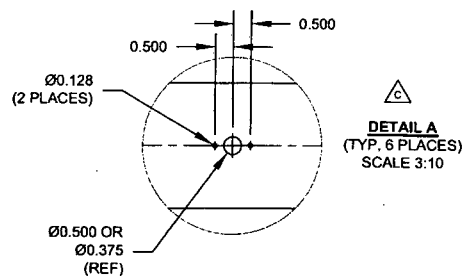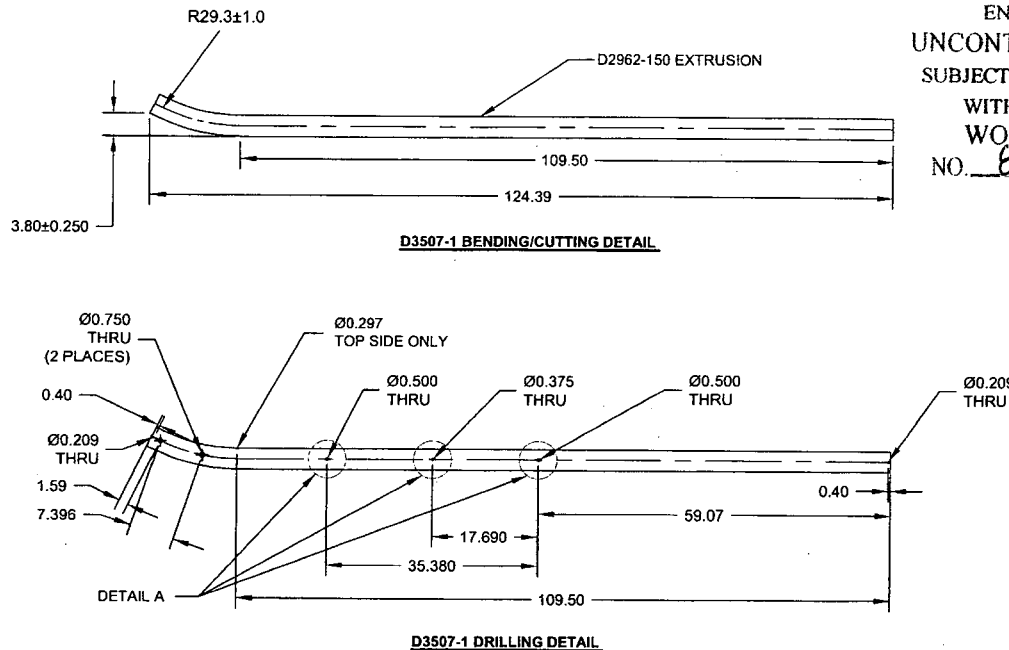


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

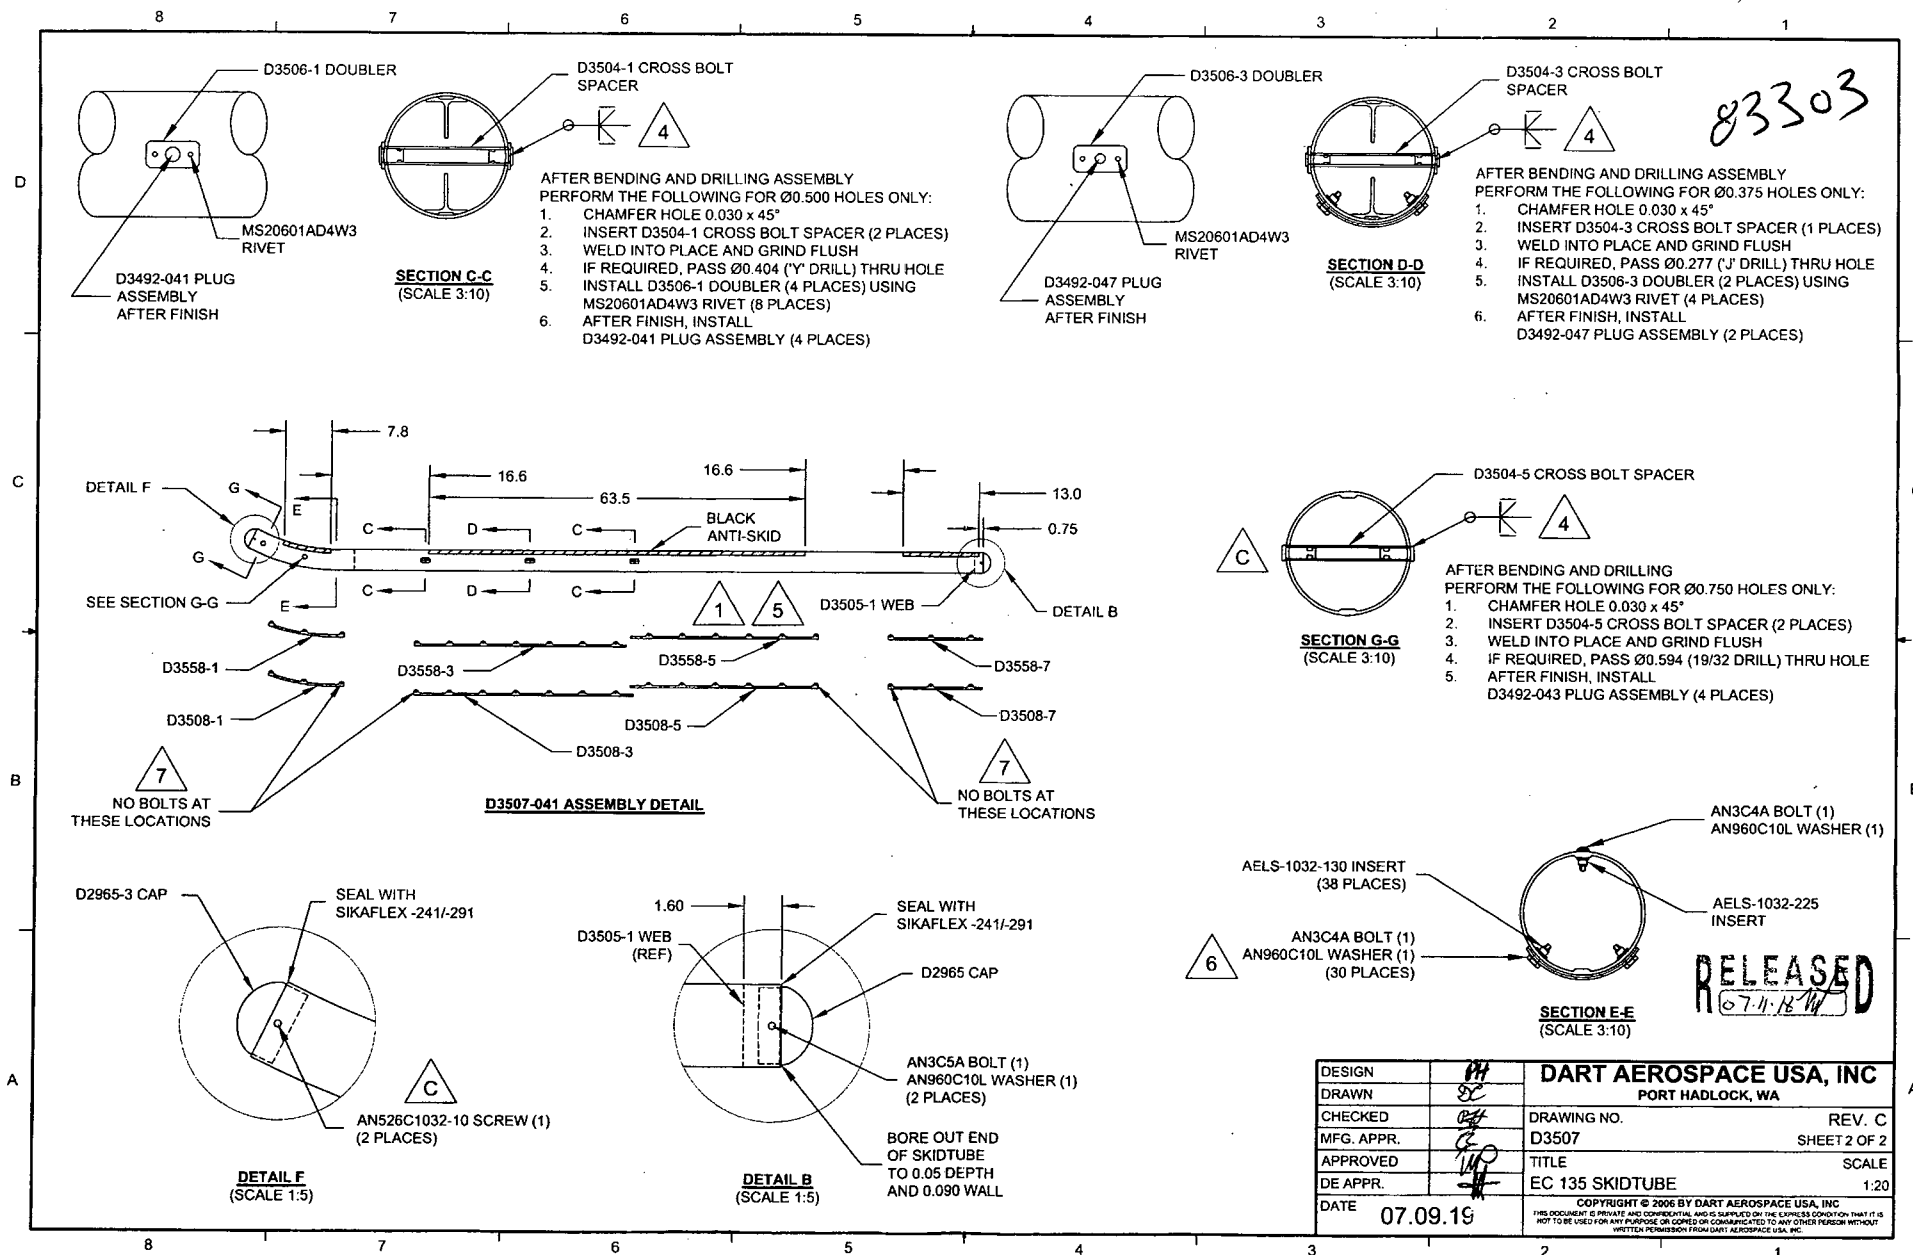

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries